Regency
the first name in solid state

PROFESSIONAL
2 WAY action radio

DATE 12/29/80

SSC Service Bulletin

no. 80-189

TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES & SERVICE CENTERS
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODELS AFFECTED: MICRO COM BU SERIES

PROBLEM: NO TRANSMITTER DISABLE WITH MA-130 INSTALLED

CURE: REPLACE R442 WITH DIODE (CATHODE TOWARDS THE BASE OF Q408), CR440, P/N 4805-1241-200 (SEE FIGURE 1)

The schematic in the Service Manual should be brought up to a Rev. F. CR440 should be put in place of R442 on the schematic and last used block CR439 changed to CR440.

TECHNICAL SERVICE DEPARTMENT

REGENCY COMMUNICATIONS, INC.

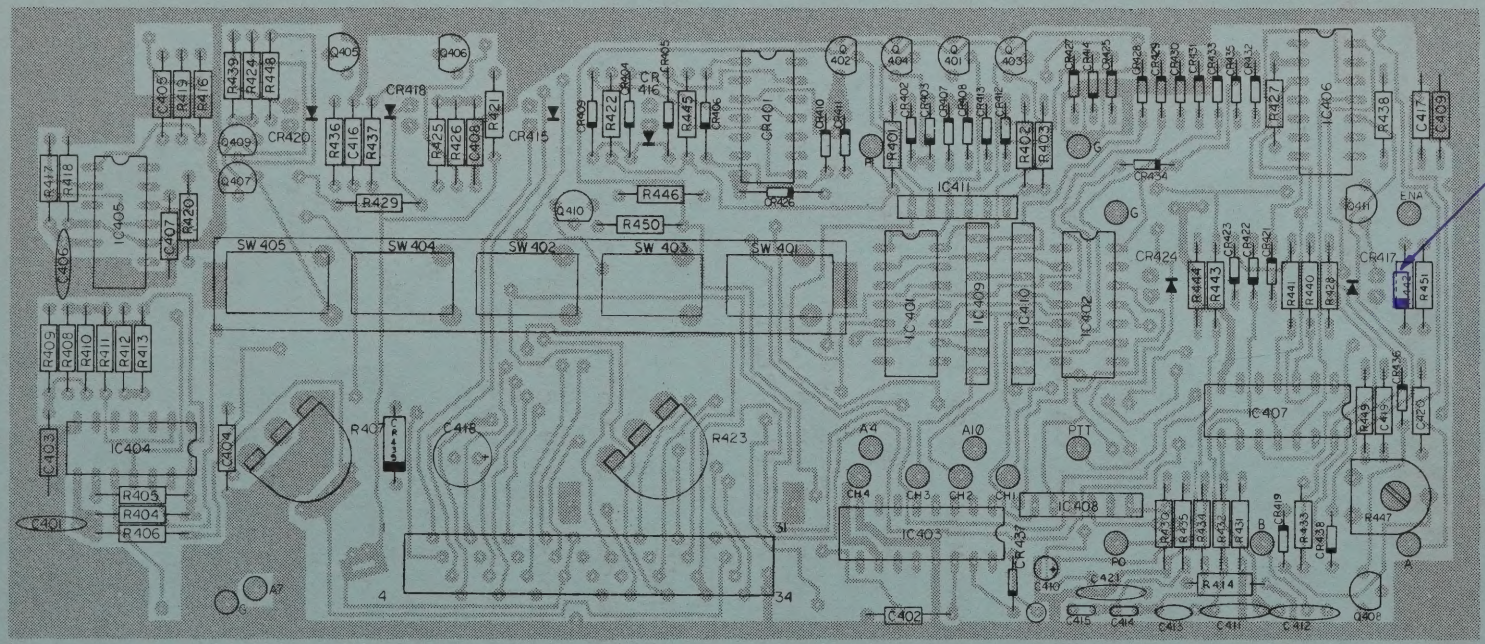
REPLACE R442
WITH CR440
SW 405
SW 404
SW 402
SW 403
SW 401
IC401
IC402
IC403
IC404
IC405
IC406
IC407
IC408
IC409
IC410
IC411
R407
R423
C418
CR418
CR420
CR415
CR416
CR417
CR424
CR434
R429
R446
R450
Q410
Q409
Q407
Q405
Q406
Q401
Q402
Q403
Q404
Q411
Q408
A4
A10
PTT
CH4
CH3
CH2
CH1
A7
G
P0
P3
A
4
34
31